



Inspection Report (<input checked="" type="checkbox"/> 1 ST <input type="checkbox"/> 2 ND)		
<input type="checkbox"/> Pre-shipment <input checked="" type="checkbox"/> ON-LINE <input type="checkbox"/> IN PROCESS <input type="checkbox"/> FULL		
Summary Section		Service Number: F-QC 202005221901
	Product Name	Snow Globe
	Item number	200115
	P/O number	...
	Quantity	30732pcs
	Client name	...
	Supplier name	...
	Inspection date	2020-05-21
	Arrival time	9 :00AM
	Departure time	15 :00PM
	Inspection location	Quanzhou, Fujian, China
Inspector	Devin	

Special Attention

1. Found completed 50pcs of products, 1000pcs finished glass balls, 20000pcs resin holder with decal, and 1200pcs holder with gloss oil.
2. Found the paillette of production was less than sample, please refer to the video for details.
3. Found the product size is smaller than the sample, please refer to the below photos.

Special Attention 2



Defective products	<input checked="" type="checkbox"/> pick out	<input type="checkbox"/> replace	<input type="checkbox"/> rework
--------------------	--	----------------------------------	---------------------------------

DETAILS
Quantity



Item Number	Ordered Quantity	Inspected Quantity	Qualified quantity	Defects quantity	Reworked quantity	Packed quantity
200115	30732	50	44	6	0	0

Defectives List			
Defectives Description	CRI	MAJ	MIN
1. Scratch mark	0	0	3
2. Residue	0	0	1
3. Missing color	0	0	2

Defectives PIC	
	
Scratch mark	Scratch mark
	
Scratch mark	Residue



Missing color



Missing color

List of test data

Item	Contract requirements	Measured data
Product size	87.4x56.8mm (sample)	74x65.2mm
Product weight	N/A	230.6g
Sample weight	N/A	231g

Product description

PRODUCT





Compared with sample



DATA MEASUREMENT

Product



Product size:

74mm



Product size:

65.2mm



Product weight:



230.6g

Sample



Product size:





87.4mm



Product size:



56.8mm

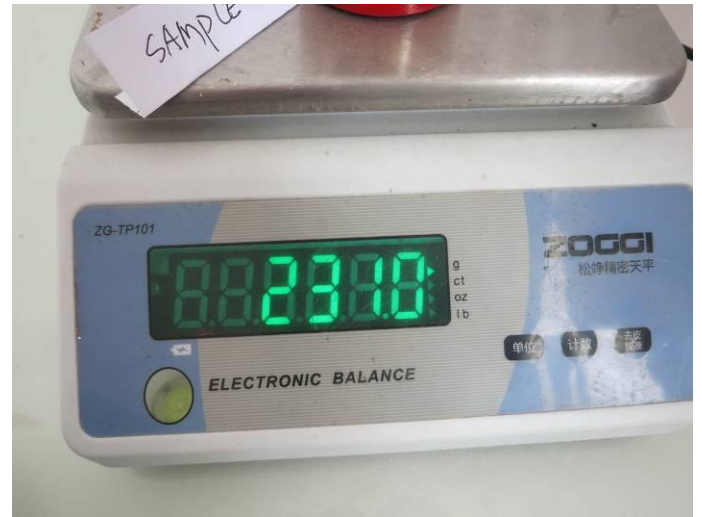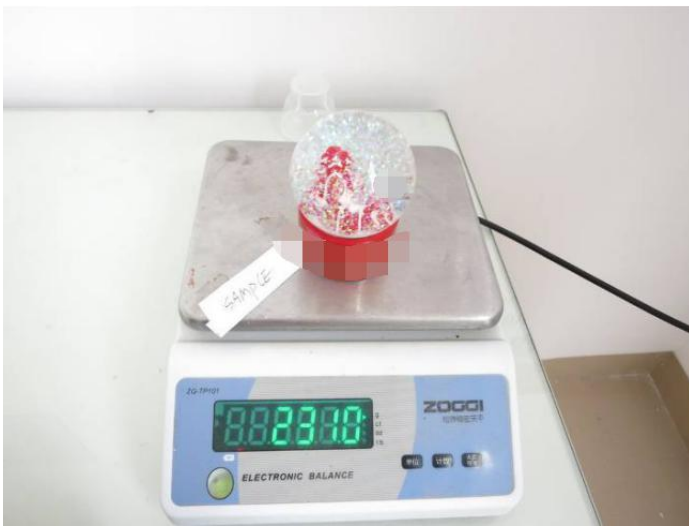

Product weight:

231g

TESTING

Tape test





Rub test



Unfinished goods



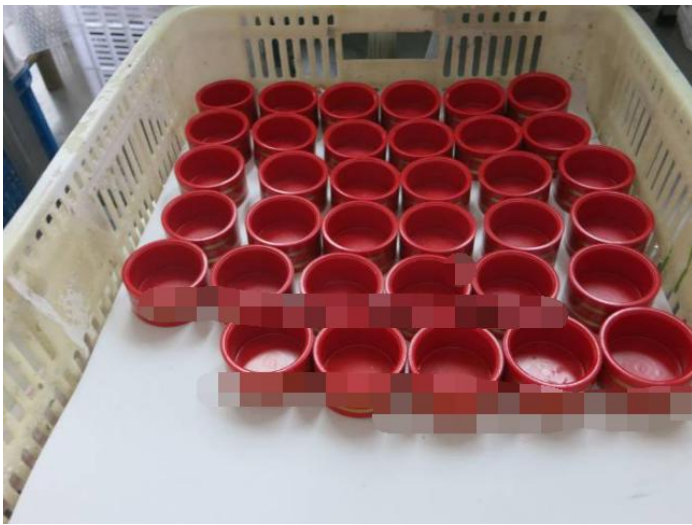


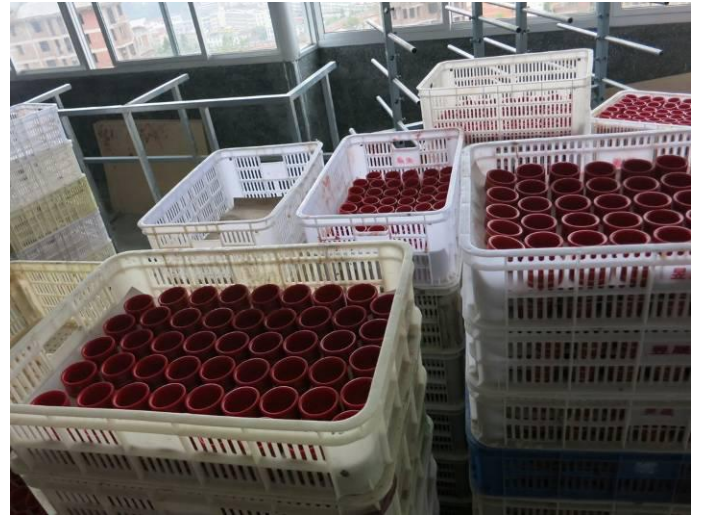





INSEPTION SPOT

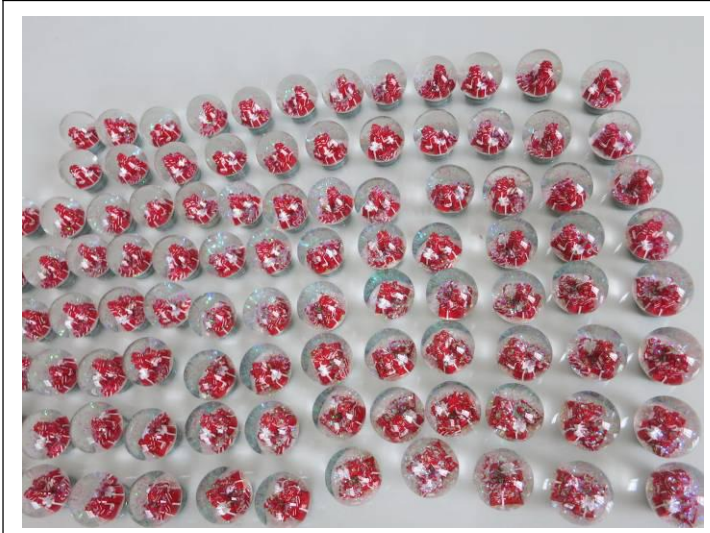

Note: This report reflects our findings at time and place of inspection.

This report does not relieve suppliers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter.

-----END OF REPORT-----